T909 PLUS INDICATOR




T900IS PLUS




T900MS PLUS

FEATURES

- LED display
- Weighing units lb, kg, g, oz
- Gross/Tare/Pre-Set Tare/Zero
- Max save 99pcs gross data
- Seach the needed gross data
- Multiple Hold functions
- Overload / Underload indication
- Configurable with multiple printers
- Splash proof keyboard and display
- Connects to a Remote Display/Scoreboard
- Power saving mode
- Ability to modify gravity based on different geographical locations
- Target lock functions
- Passcord lock functions
- RS232 output
- Optional dual load cell ports
- Connects to a remote display
- Connects to OPTIMA printers
- Displays up to 50,000 graduations
- Mounting bracket and hardware included
- Operates on 100-250V AC adapter (included)
- Drives up to 6 350ohm load cells
- 1 year limited warranty

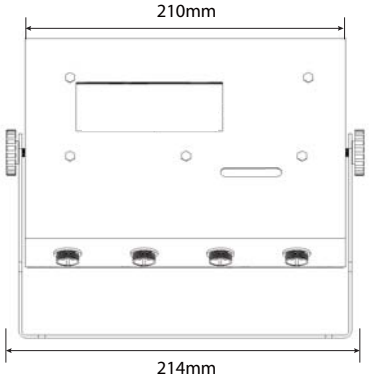

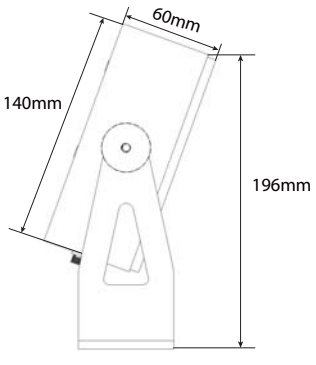

SPECIFICATIONS

Display:
LED; 1in. x 6 digit numeric
Units:
lb, kg, g, oz
Accuracy Class:
5,000 e
Zero stability error:
TK0 0.1μV//K
Span stability error:
TKspn ± 6 ppm//K
Sensitivity (internal):
0.3 μV / d
Input voltage:
-30 to +30mV DC
Excitation circuit:
5 VDC, 4 wire connection,
6 load cells of 350ohm max
AC power:
AC 100-250V (use only the included 9V adapter supplied)
Operation temperature:
-10 °C ~ +40 °C
Operation humidity:
≤90%RH
Battery:
3.7V 4400mAh lithium battery
Storage temperature:
-40 °C ~ +70 °C
Weight:
3 kg
Internal:
1/2/5/10/20/50
Decimal Points:
Selectable 0, 1, 2, 3, 4 decimal places
Interface:
RS232C
Baud Rate:
1200/2400/4800/9600/14400

Tufner Weighing Systems | www.Tufner.com | Phone ：(800)360.9619
1800-1900 North Collins Freeway Howe, TX 75459 USA